



FIGURE 5 – Split photograph showing inlet to passive treatment system (top frame) and a view of Crooked Creek (lower frame) downstream of the treatment system taken in October 2001. Note the typical orange appearance of the pond due to the iron in the discharge being oxidized.